

Dobbs Ferry Union Free School District

**Districtwide Lead in Drinking Water
Sampling and Remediation Plan**

2020-2021



ENVIROSCIENCE
CONSULTANTS INC.

2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org

Project #20627

Districtwide Lead in Drinking Water
Sampling and Remediation Plan

Performed for:

Dobbs Ferry Union Free School District
505 Broadway
Dobbs Ferry, NY 10522

May 2021

Prepared by:

Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191

Project #20627

President



Glenn Neuschwender

Districtwide Lead in Drinking Water Sampling and Remediation Plan

Table of Contents

- I. Executive Summary
- II. Sampling Methodology
- III. Initial Results

Appendix A – Springhurst Elementary School

Appendix B – Dobbs Ferry Middle School

Appendix C – Dobbs Ferry High School

May 27, 2021

Dave Robertin
Dobbs Ferry Union Free School District
505 Broadway
Dobbs Ferry, NY 10522

I. Executive Summary

The Dobbs Ferry Union Free School District has developed their 2020-2021 Lead in Drinking Water Sampling and Analysis Program, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 15 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

Within the Dobbs Ferry Union Free School District, the following locations have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Home Economics and Culinary Arts classroom sinks
- 5) Bathroom sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. For results at or below 15 ppb, no further action is required until 2025. For locations above 15 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as Non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by Enviroscience Consultants, and the fixture was shut off by the District immediately upon receipt of results.

The following locations within the Dobbs Ferry Union Free School District were deemed Non-Applicable Water Sources by the administration:

- 1) Science Laboratory sinks;
- 2) Art Room sinks;
- 3) Other classroom sinks;
- 4) Other Bathroom sinks;
- 5) Outside spigots
- 6) Custodial Closet sinks

In these cases, the District has placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks - communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks - communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Other classroom sinks - classrooms in this category often include classrooms where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 4) Other bathroom sinks – this category often includes mixed valve outlets or staff bathrooms. In intermediate buildings, signage should be sufficient for communicating the concept of hand washing only. In elementary schools, personal hygiene should be integrated into curriculum to ensure students understand bathroom sinks are for hand washing only, and not consumption. Further, show what the signage looks like in bathrooms so they learn to recognize its meaning. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Outside spigots - all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 6) Custodial Closet sinks - these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

II. Sampling Procedures:

In accordance with the regulation, Enviroscience Consultants, Inc. performed initial water sampling throughout the Dobbs Ferry Union Free School District on May 20 and 21, 2021. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours before the facilities opened. The water sources were not used for at least 8 hours and not more that 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes and the sampling location schematics are shown below.

Fixture Type Codes

BF Bottle Filler
 HB Hose Bib
 IM Ice Machine
 OS Other Source
 PF Pot Filler
 SK Sink
 SL Supply Line
 SP Spigot
 SPY Spray
 SS Slop Sink
 V Valve
 WC Water Cooler
 WF Water Fountain


Source Designations

App Applicable
 N/A Non-applicable

Remediation Type Codes

FR Fixture Replacement
 FRSLV Fixture, supply line or valve replacement
 FRSLVPA Fixture, supply line or valve replacement plumbing assessment
 SIGN Non-potable water sign posted
 CAPPED Supply line capped or fixture removed

Sampling Location Schematics

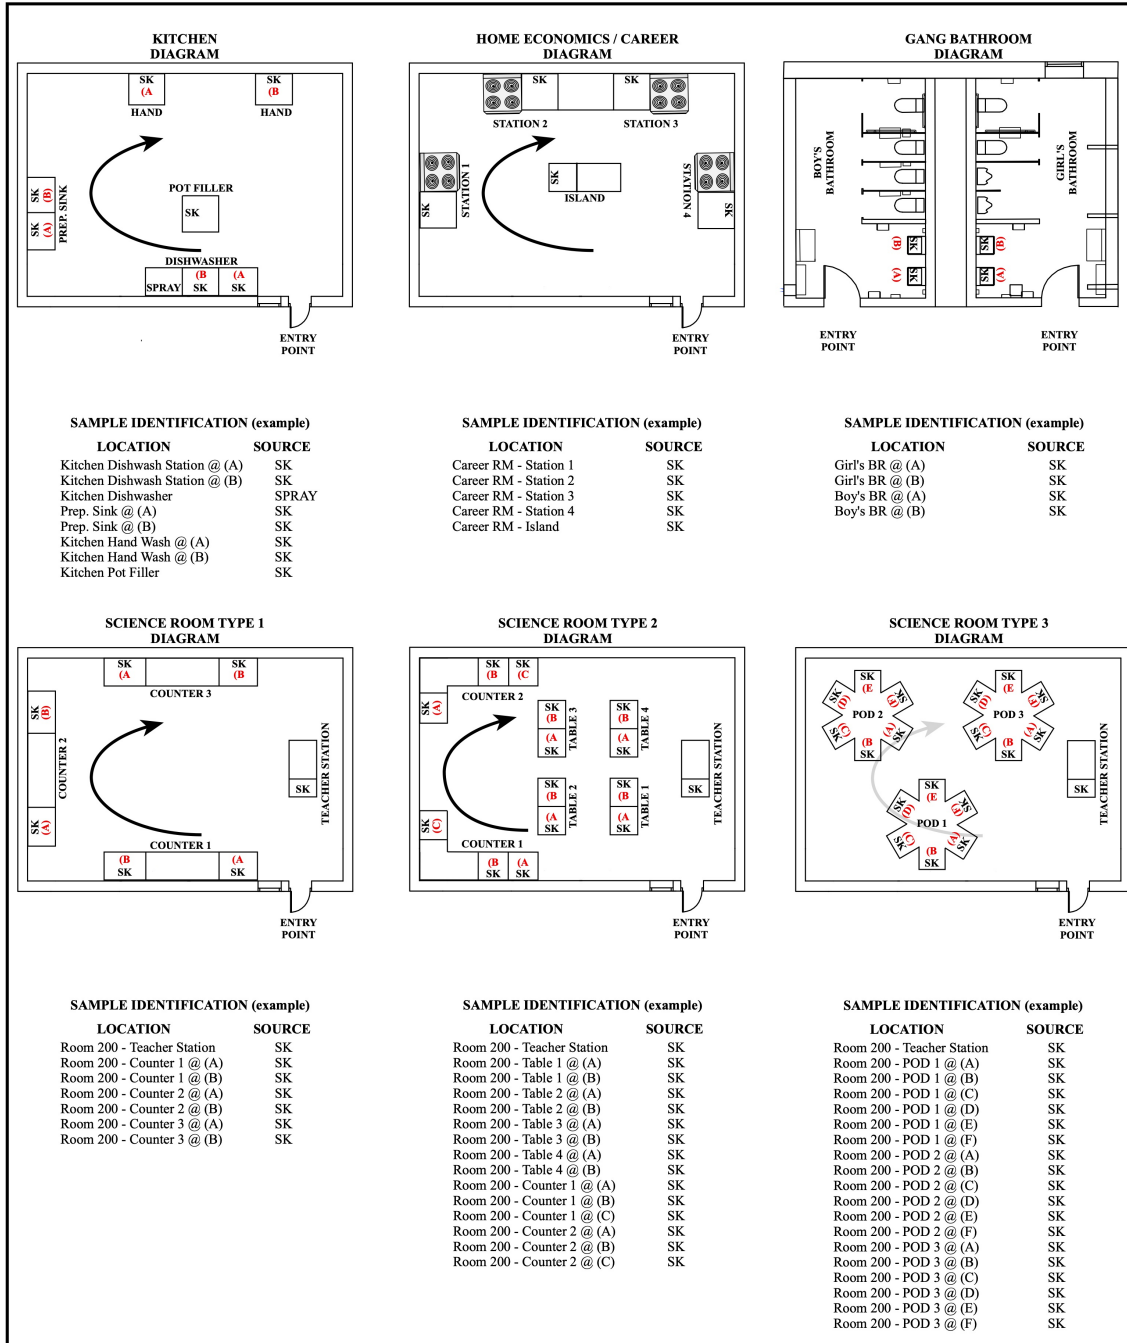

III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at Non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through D).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested before returning to service. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb:

Springhurst Elementary School

Main Kitchen Pot Filler	SP	60.6
Art Room M-57 (Left)	SK	94.3
Room M-42	SK	16.6

Dobbs Ferry Middle School

Mens Bathroom by Boys Locker Room	SK	16.7
Girls Locker Room	WF	209
Girls Locker Room (Left)	SK	34.5
Girls Locker Room (Right)	SK	58.3
All Gender Bathroom by Room M-200A/B	SK	15.8

Dobbs Ferry High School

Girls Bathroom by Room 301 (ADA Stall)	SK	16.8
New Gym Women's Locker Room (left)	SK	16.5
New Gym Women's Locker Room (right)	SK	33.1
Board Room Bathroom	SK	17.6
Girls Bathroom by Business Office (ADA Stall)	SK	20
Girls Bathroom by Room 301 (ADA Stall)	SK	16.8

Appendix A

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Room M-24	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1001-2	Room M-24	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1002-1	Room M-22	SK	App	3.37	5/21/2021	-	-	-	None	-	-	-
1003-1	Gender Neutral Bathroom by Room M-22	SK	App	1.25	5/21/2021	-	-	-	None	-	-	-
1004-1	Boys Bathroom by Room M-22 (Right)	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1004-2	Boys Bathroom by Room M-22 (Middle Right)	SK	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1004-3	Boys Bathroom by Room M-22 (Middle Left)	SK	App	1.03	5/21/2021	-	-	-	None	-	-	-
1004-4	Boys Bathroom by Room M-22 (Left)	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1005-1	Hall by Room M-22	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1005-2	Hall by Room M-22 (Bottle Filler)	BF	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1006-1	Girls Bathroom by Room M-22 (Left)	SK	App	1.03	5/21/2021	-	-	-	None	-	-	-
1006-2	Girls Bathroom by Room M-22 (Middle Left)	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1006-3	Girls Bathroom by Room M-22 (Middle Right)	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1006-4	Girls Bathroom by Room M-22 (Right)	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1007-1	Custodial Closet by Room M-22	SS	N/A		5/21/2021	-	-	-	None	Locked door	-	-
1008-1	Room M-19	WF	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1008-2	Room M-19	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1009-1	Room M-18	WF	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1009-2	Room M-18	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1010-1	Room M-20	WF	App		5/21/2021	-	-	-	None	Locked door	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1010-2	Room M-20	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1011-1	Room M-17	WF	App		5/21/2021	-	-	-	None	Locked door	-	-
1011-2	Room M-17	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1012-1	Gender Neutral Bathroom by Room M-17	SK	App	2.1	5/21/2021	-	-	-	None	-	-	-
1013-1	Art Room M-16 (Right)	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1013-2	Art Room M-16 (Middle Right)	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1013-3	Art Room M-16 (Middle Left)	WF	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1013-4	Art Room M-16 (Middle Left)	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1013-5	Art Room M-16 (Left)	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1013-6	Art Room M-16 (Left)	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1014-1	Room M-15	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1014-2	Room M-15	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1015-1	Room M-14	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1015-2	Room M-14	SK	App	3.17	5/21/2021	-	-	-	None	-	-	-
1016-1	Room M-13	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1016-2	Room M-13	SK	App	1.07	5/21/2021	-	-	-	None	-	-	-
1017-1	Room M-12	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1017-2	Room M-12	SK	App	1.3	5/21/2021	-	-	-	None	-	-	-
1018-1	Room M-11	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1018-2	Room M-11	SK	App	1.74	5/21/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1019-1	Room M-10	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1019-2	Room M-10	SK	App	1.93	5/21/2021	-	-	-	None	-	-	-
1020-1	Room M-8	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1020-2	Room M-8	SK	App	3.03	5/21/2021	-	-	-	None	-	-	-
1021-1	Room M-9	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1021-2	Room M-9	SK	App	2.19	5/21/2021	-	-	-	None	-	-	-
1022-1	Room M-7	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1022-2	Room M-7	SK	App	3.46	5/21/2021	-	-	-	None	-	-	-
1023-1	Room M-6	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1023-2	Room M-6	SK	App	3.26	5/21/2021	-	-	-	None	-	-	-
1024-1	Room M-5	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1024-2	Room M-5	SK	App	2.58	5/21/2021	-	-	-	None	-	-	-
1025-1	Room M-3	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1025-2	Room M-3	SK	App	2.02	5/21/2021	-	-	-	None	-	-	-
1026-1	Custodial Closet by Room M-3	SS	N/A		5/21/2021	-	-	-	None	Locked door	-	-
1027-1	Hall by Room M-59	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1028-1	Gender Neutral Bathroom by Room M-59	SK	App	9.14	5/21/2021	-	-	-	None	-	-	-
1029-1	Room M-60 Closet	SK	App	7.49	5/21/2021	-	-	-	None	-	-	-
1030-1	Room M-61 Bathroom	SK	App	5.1	5/21/2021	-	-	-	None	-	-	-
1031-1	Cafeteria	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1031-2	Cafeteria (Bottle Filler)	BF	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1031-3	Cafeteria Girls Bathroom	SK	App	1.19	5/21/2021	-	-	-	None	-	-	-
1031-4	Cafeteria Boys Bathroom	SK	App	1.15	5/21/2021	-	-	-	None	-	-	-
1032-1	Kitchen Staff Bathroom	SK	App	2.34	5/21/2021	-	-	-	None	-	-	-
1032-2	Kitchen Serving Line Handwash (Right)	SK	N/A		5/21/2021	-	-	-	Sign Required	-	-	-
1032-3	Kitchen Serving Line Handwash (Left)	SK	N/A		5/21/2021	-	-	-	Sign Required	-	-	-
1032-4	Kitchen Serving Line Buffet Tray Bay (Right)	SP	N/A		5/21/2021	-	-	-	Sign Required	-	-	-
1032-5	Kitchen Serving Line Buffet Tray Bay (Left)	SP	N/A		5/21/2021	-	-	-	Sign Required	-	-	-
1032-6	Main Kitchen Handwash by Vulcan Stove	SK	N/A		5/21/2021	-	-	-	Sign Required	-	-	-
1032-7	Main Kitchen 3 Bay (Right)	SK	App	2.23	5/21/2021	-	-	-	None	-	-	-
1032-8	Main Kitchen 3 Bay (Left)	SK	App	1.36	5/21/2021	-	-	-	None	-	-	-
1032-9	Main Kitchen Handwash by 3 Bay	SK	N/A		5/21/2021	-	-	-	Sign Required	-	-	-
1032-10	Main Kitchen 2 Bay Food Prep	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1032-11	Main Kitchen Pot Filler	SP	App	60.6	5/21/2021				Additional Sampling Required			
1033-1	Cutodial Closet by Faculty Room M-56	SS	N/A		5/21/2021	-	-	-	None	Locked door	-	-
1034-1	Faculty Room M-56 Left Bathroom	SK	N/A		5/21/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1034-2	Faculty Room M-56 Right Bathroom	SK	N/A		5/21/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1034-3	Faculty Room M-56	SK	App	3.63	5/21/2021	-	-	-	None	-	-	-
1035-1	Art Room M-57 (Right)	SK	App	3.18	5/21/2021	-	-	-	None	-	-	-
1035-2	Art Room M-57 (Middle Right)	SK	App	4.53	5/21/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1035-3	Art Room M-57 (Middle Left)	SK	App	10.9	5/21/2021	-	-	-	None	-	-	-
1035-4	Art Room M-57 (Left)	SK	App	94.3	5/21/2021				Additional Sampling Required			
1036-1	Custodial Office Bathroom	SK	N/A		5/21/2021	-	-	-	Sign Required	-	-	-
1037-1	Girls Bathroom by Gym (Right)	SK	App	2.29	5/21/2021	-	-	-	None	-	-	-
1037-2	Girls Bathroom by Gym (Left)	SK	App	1.08	5/21/2021	-	-	-	None	-	-	-
1038-1	Boys Bathroom by Gym (Left)	SK	App	1.5	5/21/2021	-	-	-	None	-	-	-
1038-2	Boys Bathroom by Gym (Right)	SK	App	1.37	5/21/2021	-	-	-	None	-	-	-
1039-1	Hall by Gym	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1039-2	Hall by Gym (Bottle Filler)	BF	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1040-1	Staff Bathroom by Gym	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
1041-1	Custodial Closet by Gym	SS	N/A		5/21/2021	-	-	-	None	Locked door	-	-
1042-1	Room M-54	SK	App	1.86	5/21/2021	-	-	-	None	-	-	-
1043-1	Hall by Room M-54	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1044-1	Room M-50	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1044-2	Room M-50	SK	App	4.61	5/21/2021	-	-	-	None	-	-	-
1045-1	Room M-52	SK	App	6.4	5/21/2021	-	-	-	None	-	-	-
1046-1	Room M-48	SK	App	6.8	5/21/2021	-	-	-	None	-	-	-
1047-1	Room M-47	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1047-2	Room M-47	SK	App	2.86	5/21/2021	-	-	-	None	-	-	-
1048-1	Room M-46	SK	App	4.54	5/21/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1049-1	Custodial Closet by Room M-46	SS	N/A		5/21/2021	-	-	-	None	Locked door	-	-
1050-1	Room M-44	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1050-2	Room M-44	SK	App	10.3	5/21/2021	-	-	-	None	-	-	-
1051-1	Room M-45	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1051-2	Room M-45	SK	App	4.86	5/21/2021	-	-	-	None	-	-	-
1052-1	Room M-42	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1052-2	Room M-42	SK	App	16.6	5/21/2021				Additional Sampling Required			
1053-1	Room M-43	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1053-2	Room M-43	SK	App	3.14	5/21/2021	-	-	-	None	-	-	-
1054-1	Girls Bathroom by Room M-41 (Right)	SK	App		5/21/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1054-2	Girls Bathroom by Room M-41 (Left)	SK	App	8.76	5/21/2021	-	-	-	None	-	-	-
1055-1	Room M-41	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1055-2	Room M-41	SK	App	4.3	5/21/2021	-	-	-	None	-	-	-
1056-1	Custodial Closet by Room M-41	SS	N/A		5/21/2021	-	-	-	None	Locked door	-	-
1057-1	Boys Bathroom by Room M-41 (Left)	SK	N/A		5/21/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1057-2	Boys Bathroom by Room M-41 (Right)	SK	N/A		5/21/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1058-1	Room M-39	WF	App	2.8	5/21/2021	-	-	-	None	-	-	-
1058-2	Room M-39	SK	App	6.42	5/21/2021	-	-	-	None	-	-	-
1059-1	Room M-40	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
1059-2	Room M-40	SK	App	5.22	5/21/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1060-1	Room M-38	WF	N/A		5/21/2021	-	-	-	None	Sign Posted/Removed fromservice	-	-
1060-2	Room M-38	SK	N/A		5/21/2021	-	-	-	None	Sign Posted/Removed fromservice	-	-
1061-1	Nurses Office Room M-37	WF	App	3.03	5/21/2021	-	-	-	None	-	-	-
1061-2	Nurses Office Room M-37	SK	App	8.63	5/21/2021	-	-	-	None	-	-	-
0001-1	Hall by Hot Water Boiler Room	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
0001-2	Hall by Hot Water Boiler Room (Bottle Filler)	BF	App	<1.0	5/21/2021	-	-	-	None	-	-	-
0002-1	Boys Bathroom by Boiler Room (Right)	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
0002-2	Boys Bathroom by Boiler Room (Middle)	SK	App	1.27	5/21/2021	-	-	-	None	-	-	-
0002-3	Boys Bathroom by Boiler Room (Left)	SK	App	1.81	5/21/2021	-	-	-	None	-	-	-
0003-1	Girls Bathroom by Boiler Room (Left)	SK	App	1.57	5/21/2021	-	-	-	None	-	-	-
0003-2	Girls Bathroom by Boiler Room (Middle)	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
0003-3	Girls Bathroom by Boiler Room (Right)	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
0004-1	Room G-33	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
0004-2	Room G-33	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
0005-1	Room G-32	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
0005-2	Room G-32	SK	App	1.09	5/21/2021	-	-	-	None	-	-	-
0006-1	Room G-31	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
0007-1	Staff Bathroom by Room G-31	SK	App	1.07	5/21/2021	-	-	-	None	-	-	-
0008-1	Room G-30	SK	App	4.04	5/21/2021	-	-	-	None	-	-	-
0009-1	Room G-29	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0009-2	Room G-29	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
0010-1	Room G-28	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
0010-2	Room G-28	SK	App	<1.0	5/21/2021	-	-	-	None	-	-	-
0011-1	Room G-26	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
0011-2	Room G-26	SK	App	1.29	5/21/2021	-	-	-	None	-	-	-
0012-1	Hot Water Boiler Room	SS	N/A		5/21/2021	-	-	-	None	Locked door	-	-
0013-1	Steam Boiler Room by Café	SS	N/A		5/21/2021	-	-	-	None	Locked door	-	-
2001-1	Boys Bathroom by Room S-65 (Left)	SK	App		5/21/2021	-	-	-	None	Removed from Service	-	-
2001-2	Boys Bathroom by Room S-65 (Right)	SK	App	4.59	5/21/2021	-	-	-	None	-	-	-
2002-1	Staff Bathroom by Library Room S-64	SK	App	4.58	5/21/2021	-	-	-	None	-	-	-
2003-1	Girls Bathroom by Library Room S-64 (Left)	SK	App	5.33	5/21/2021	-	-	-	None	-	-	-
2003-2	Girls Bathroom by Library Room S-64 (Right)	SK	App	5.36	5/21/2021	-	-	-	None	-	-	-
2004-1	Hall by Library Room S-64	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
2004-2	Hall by Library Room S-64 (Bottle Filler)	BF	App	<1.0	5/21/2021	-	-	-	None	-	-	-
2005-1	Room S-66	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
2005-2	Room S-66	SK	App	5.53	5/21/2021	-	-	-	None	-	-	-
2006-1	Room S-68	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
2006-2	Room S-68	SK	App	5.26	5/21/2021	-	-	-	None	-	-	-
2007-1	Room S-69	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
2007-2	Room S-69	SK	App	5.99	5/21/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2008-1	Room-S71	WF	App		5/21/2021	-	-	-	None	Removed from Service	-	-
2008-2	Room-S71	SK	App	3.19	5/21/2021	-	-	-	None	-	-	-
2009-1	Room S-73	SK	App	4.95	5/21/2021	-	-	-	None	-	-	-
2010-1	Room S-72	SK	App	3.89	5/21/2021	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2212311-17961

May 25, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Springhurst Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 21, 2021. New York Environmental analyzed the samples on May 24, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	21 May 2021
Date Received:	21 May 2021
Date Analyzed:	24 May 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210521L007	1	Room M-24-SK; Initial	1.00	<1.00	µg/L	
210521L008	2	Room M-22-SK; Initial	1.00	3.37	µg/L	
210521L009	3	Gender Neutral Bathroom by Room M-22-SK; Initial	1.00	1.25	µg/L	
210521L010	4	Boys Bathroom by Room M-22 (Right)-SK; Initial	1.00	<1.00	µg/L	
210521L011	5	Boys Bathroom by Room M-22 (Middle Left)-SK; Initial	1.00	1.03	µg/L	
210521L012	6	Boys Bathroom by Room M-22 (Left)-SK; Initial	1.00	<1.00	µg/L	
210521L013	7	Hall by Room M-22 (Bottle Filler)-BF; Initial	1.00	<1.00	µg/L	
210521L014	8	Girls Bathroom by Room M-22 (Left)-SK; Initial	1.00	1.03	µg/L	
210521L015	9	Girls Bathroom by Room M-22 (Middle Left)-SK; Initial	1.00	<1.00	µg/L	
210521L016	10	Girls Bathroom by Room M-22 (Middle Right)-SK; Initial	1.00	<1.00	µg/L	
210521L017	11	Girls Bathroom by Room M-22 (Right)-SK; Initial	1.00	<1.00	µg/L	
210521L018	12	Room M-19-SK; Initial	1.00	<1.00	µg/L	
210521L019	13	Room M-18-SK; Initial	1.00	<1.00	µg/L	
210521L020	14	Room M-20-SK; Initial	1.00	<1.00	µg/L	
210521L021	15	Room M-17-SK; Initial	1.00	<1.00	µg/L	
210521L022	16	Gender Neutral Bathroom by Room M-17-SK; Initial	1.00	2.10	µg/L	
210521L023	17	Art Room M-16 (Right)-SK; Initial	1.00	<1.00	µg/L	
210521L024	18	Art Room M-16 (Middle Right)-SK; Initial	1.00	<1.00	µg/L	
210521L025	19	Art Room M-16 (Middle Left)-SK; Initial	1.00	<1.00	µg/L	
210521L026	20	Art Room M-16 (Left)-SK; Initial	1.00	<1.00	µg/L	
210521L027	21	Room M-15-SK; Initial	1.00	<1.00	µg/L	
210521L028	22	Room M-14-SK; Initial	1.00	3.17	µg/L	
210521L029	23	Room M-13-SK; Initial	1.00	1.07	µg/L	
210521L030	24	Room M-12-SK; Initial	1.00	1.30	µg/L	
210521L031	25	Room M-11-SK; Initial	1.00	1.74	µg/L	
210521L032	26	Room M-10-SK; Initial	1.00	1.93	µg/L	



Date Collected:	21 May 2021
Date Received:	21 May 2021
Date Analyzed:	24 May 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210521L033	27	Room M-8-SK; Initial	1.00	3.03	µg/L	
210521L034	28	Room M-9-SK; Initial	1.00	2.19	µg/L	
210521L035	29	Room M-7-SK; Initial	1.00	3.46	µg/L	
210521L036	30	Room M-6-SK; Initial	1.00	3.26	µg/L	
210521L037	31	Room M-5-SK; Initial	1.00	2.58	µg/L	
210521L038	32	Room M-3-SK; Initial	1.00	2.02	µg/L	
210521L039	33	Gender Neutral Bathroom by Room M-59-SK; Initial	1.00	9.14	µg/L	
210521L040	34	Room M-60 Closet-SK; Initial	1.00	7.49	µg/L	
210521L041	35	Room M-61 Bathroom-SK; Initial	1.00	5.10	µg/L	
210521L042	36	Cafeteria (Bottle Filler)-BF; Initial	1.00	<1.00	µg/L	
210521L043	37	Cafeteria Girls Bathroom-SK; Initial	1.00	1.19	µg/L	
210521L044	38	Cafeteria Boys Bathroom-SK; Initial	1.00	1.15	µg/L	
210521L045	39	Kitchen Staff Bathroom-SK; Initial	1.00	2.34	µg/L	
210521L046	40	Main Kitchen 3 Bay (Right)-SK; Initial	1.00	2.23	µg/L	
210521L047	41	Main Kitchen 3 Bay (Left)-SK; Initial	1.00	1.36	µg/L	
210521L048	42	Main Kitchen 2 Bay Food Prep-SK; Initial	1.00	<1.00	µg/L	
210521L049	43	Main Kitchen Pot Filler-SP; Initial	1.00	60.6	µg/L	E,H
210521L050	44	Faculty Room M-56-SK; Initial	1.00	3.63	µg/L	
210521L051	45	Art Room M-57 (Right)-SK; Initial	1.00	3.18	µg/L	
210521L052	46	Art Room M-57 (Middle Right)-SK; Initial	1.00	4.53	µg/L	
210521L053	47	Art Room M-57 (Middle Left)-SK; Initial	1.00	10.9	µg/L	
210521L054	48	Art Room M-57 (Left)-SK; Initial	1.00	94.3	µg/L	E,H
210521L055	49	Girls Bathroom by Gym (Right)-SK; Initial	1.00	2.29	µg/L	
210521L056	50	Girls Bathroom by Gym (Left)-SK; Initial	1.00	1.08	µg/L	
210521L057	51	Boys Bathroom by Gym (Left)-SK; Initial	1.00	1.50	µg/L	
210521L058	52	Boys Bathroom by Gym (Right)-SK; Initial	1.00	1.37	µg/L	
210521L059	53	Hall by Gym (Bottle Filler)-BF; Initial	1.00	<1.00	µg/L	



Date Collected:	21 May 2021
Date Received:	21 May 2021
Date Analyzed:	24 May 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210521L060	54	Staff Bathroom by Gym-SK; Initial	1.00	<1.00	µg/L	
210521L061	55	Room M-54-SK; Initial	1.00	1.86	µg/L	
210521L062	56	Room M-50-SK; Initial	1.00	4.61	µg/L	
210521L063	57	Room M-52-SK; Initial	1.00	6.40	µg/L	
210521L064	58	Room M-48-SK; Initial	1.00	6.80	µg/L	
210521L065	59	Room M-47-SK; Initial	1.00	2.86	µg/L	
210521L066	60	Room M-46-SK; Initial	1.00	4.54	µg/L	
210521L067	61	Room M-44-SK; Initial	1.00	10.3	µg/L	
210521L068	62	Room M-45-SK; Initial	1.00	4.86	µg/L	
210521L069	63	Room M-42-SK; Initial	1.00	16.6	µg/L	H
210521L070	64	Room M-43-SK; Initial	1.00	3.14	µg/L	
210521L071	65	Girls Bathroom by Room M-41 (Left)-SK; Initial	1.00	8.76	µg/L	
210521L072	66	Room M-41-SK; Initial	1.00	4.30	µg/L	
210521L073	67	Room M-39-WF; Initial	1.00	2.80	µg/L	
210521L074	68	Room M-39-SK; Initial	1.00	6.42	µg/L	
210521L075	69	Room M-40-SK; Initial	1.00	5.22	µg/L	
210521L076	70	Nurses Office Room M-37-WF; Initial	1.00	3.03	µg/L	
210521L077	71	Nurses Office Room M-37-SK; Initial	1.00	8.63	µg/L	
210521L078	72	Hall by Hot Water Boiler Room (Bottle Filler)-BF; Initial	1.00	<1.00	µg/L	
210521L079	73	Boys Bathroom by Boiler Room (Right)-SK; Initial	1.00	<1.00	µg/L	
210521L080	74	Boys Bathroom by Boiler Room (Middle)-SK; Initial	1.00	1.27	µg/L	
210521L081	75	Boys Bathroom by Boiler Room (Left)-SK; Initial	1.00	1.81	µg/L	
210521L082	76	Girls Bathroom by Boiler Room (Left)-SK; Initial	1.00	1.57	µg/L	
210521L083	77	Girls Bathroom by Boiler Room (Middle)-SK; Initial	1.00	<1.00	µg/L	
210521L084	78	Girls Bathroom by Boiler Room (Right)-SK; Initial	1.00	<1.00	µg/L	
210521L085	79	Room G-33-SK; Initial	1.00	<1.00	µg/L	
210521L086	80	Room G-32-SK; Initial	1.00	1.09	µg/L	



Date Collected:	21 May 2021
Date Received:	21 May 2021
Date Analyzed:	24 May 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210521L087	81	Room G-31-SK; Initial	1.00	<1.00	µg/L	
210521L088	82	Staff Bathroom by Room G-31-SK; Initial	1.00	1.07	µg/L	
210521L089	83	Room G-30-SK; Initial	1.00	4.04	µg/L	
210521L090	84	Room G-29-SK; Initial	1.00	<1.00	µg/L	
210521L091	85	Room G-28-SK; Initial	1.00	<1.00	µg/L	
210521L092	86	Room G-26-SK; Initial	1.00	1.29	µg/L	
210521L093	87	Boys Bathroom by Room S-65 (Right)-SK; Initial	1.00	4.59	µg/L	
210521L094	88	Staff Bathroom by Library Room S-64-SK; Initial	1.00	4.58	µg/L	
210521L095	89	Girls Bathroom by Library Room S-64 (Left)-SK; Initial	1.00	5.33	µg/L	
210521L096	90	Girls Bathroom by Library Room S-64 (Right)-SK; Initial	1.00	5.36	µg/L	
210521L097	91	Hall by Library Room S-64 (Bottle Filler)-BF; Initial	1.00	<1.00	µg/L	
210521L098	92	Room S-66-SK; Initial	1.00	5.53	µg/L	
210521L099	93	Room S-68-SK; Initial	1.00	5.26	µg/L	
210521L100	94	Room S-69-SK; Initial	1.00	5.99	µg/L	
210521L101	95	Room-S71-SK; Initial	1.00	3.19	µg/L	
210521L102	96	Room S-73-SK; Initial	1.00	4.95	µg/L	
210521L103	97	Room S-72-SK; Initial	1.00	3.89	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix B

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	All Gender Bathroom	SK	App	1.1	5/20/2021	-	-	-	None	-	-	-
1002-1	Girl's Bathroom by Faculty Room	SK	App	4.2	5/20/2021	-	-	-	None	-	-	-
1003-1	Boy's Bathroom by Faculty Room	SK	App	14.9	5/20/2021	-	-	-	None	-	-	-
1004-1	Hall by Faculty Room	WF	App		5/20/2021	-	-	-	None	Removed from Service	-	-
1004-2	Hall by Faculty Room	BF	App	<1.0	5/20/2021	-	-	-	None	-	-	-
1005-1	Faculty Room	SK	App	1.64	5/20/2021	-	-	-	None	-	-	-
1005-2	Faculty Room	SPY	App	<1.0	5/20/2021	-	-	-	None	-	-	-
1006-1	Custodial Closet by M-117	SS	N/A		5/20/2021	-	-	-	None	Locked Door	-	-
1007-1	Boy's Bathroom by Cafeteria	SK	App	<1.0	5/20/2021	-	-	-	None	-	-	-
1008-1	Girl's Bathroom by Cafeteria	SK	App	<1.0	5/20/2021	-	-	-	None	-	-	-
1009-1	Cafeteria (right)	WF	App		5/20/2021	-	-	-	None	Removed from Service	-	-
1009-2	Cafeteria (left)	WF	App		5/20/2021	-	-	-	None	Removed from Service	-	-
1009-3	Cafeteria (left)	BF	App	<1.0	5/20/2021	-	-	-	None	-	-	-
1009-4	Cafeteria-East side	BF	App	<1.0	5/20/2021	-	-	-	None	-	-	-
1010-1	Kitchen Ice Machine	IM	App	<1.0	5/20/2021	-	-	-	None	-	-	-
1010-2	Kitchen Handwash 1	SK	N/A		5/20/2021	-	-	-	None	SIGN	-	-
1010-3	Kitchen Potfiller	PF	App	2.11	5/20/2021	-	-	-	None	-	-	-
1010-4	Kitchen Island 2-Bay	SK	App	<1.0	5/20/2021	-	-	-	None	-	-	-
1010-5	Kitchen Handwash 2	SK	N/A		5/20/2021	-	-	-	None	SIGN	-	-
1010-6	Kitchen 3-Bay Dishwash Station-right	SK	App	<1.0	5/20/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1010-6	Kitchen 3-Bay Dishwash Station-left	SK	App	<1.0	5/20/2021	-	-	-	None	-	-	-
1010-7	Kitchen Handwash 3	SK	N/A		5/20/2021	-	-	-	None	SIGN	-	-
1010-8	Kitchen Serving Line (left) by ice cream machine	SK	App	2.38	5/20/2021	-	-	-	None	-	-	-
1010-9	Kitchen Serving Line handwash 4	SK	N/A		5/20/2021	-	-	-	None	SIGN	-	-
1010-10	Kitchen Serving Line (right) by coffee machine	SK	App	<1.0	5/20/2021	-	-	-	None	-	-	-
1011-1	Kitchen Locker Room Bathroom	SK	App	4.08	5/20/2021	-	-	-	None	-	-	-
1012-1	Mens Bathroom by Boys Locker Room	SK	App	16.7	5/20/2021	-	-	-	Additional Sampling Required	-	-	-
1013-1	Boys Locker Room Bathroom	SK	App	6.01	5/20/2021	-	-	-	None	-	-	-
1013-2	Boys Locker Room	WF	App		5/20/2021	-	-	-	None	Removed from service	-	-
1014-1	All Gender Bathroom by Girls Locker Room	SK	App	7.62	5/20/2021	-	-	-	None	-	-	-
1015-1	Girls Locker Room Bathroom	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1016-1	Girls Locker Room	WF	App	209	5/20/2021	-	-	-	Additional Sampling Required	-	-	-
1016-2	Girls Locker Room (Left)	SK	App	34.5	5/20/2021	-	-	-	Additional Sampling Required	-	-	-
1016-3	Girls Locker Room (Right)	SK	App	58.3	5/20/2021	-	-	-	Additional Sampling Required	-	-	-
1017-1	Room 112 Art	SK	App	2.58	5/20/2021	-	-	-	None	-	-	-
1018-1	Main Office Kitchen	SK	App	2.03	5/20/2021	-	-	-	None	-	-	-
1019-1	Room M-103	SS	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2001-1	Hall by Room M-220	WF	App		5/20/2021	-	-	-	None	Removed from Service	-	-
2001-2	Hall by Room M-220	BF	App	<1.0	5/20/2021	-	-	-	None	-	-	-
2002-1	Boy's Bathroom by Room M-220 (left)	SK	App	2.87	5/20/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2002-2	Boy's Bathroom by Room M-220 (right)	SK	App	5.5	5/20/2021	-	-	-	None	-	-	-
2003-1	Girl's Bathroom by Room M-220 (left)	SK	App	3.71	5/20/2021	-	-	-	None	-	-	-
2003-2	Girl's Bathroom by Room M-220 (right)	SK	App	2.88	5/20/2021	-	-	-	None	-	-	-
2004-1	All Gender Bathroom by Room M-200A/B	SK	App	15.8	5/20/2021				Additional Sampling Required		-	-
2005-1	Boy's Bathroom by Room M-219 (left)	SK	App	3.67	5/20/2021	-	-	-	None	-	-	-
2005-2	Boy's Bathroom by Room M-219 (right)	SK	App	4.99	5/20/2021	-	-	-	None	-	-	-
2006-1	Girl's Bathroom by Room M-219 (left)	SK	App	1.99	5/20/2021	-	-	-	None	-	-	-
2006-2	Girl's Bathroom by Room M-219 (right)	SK	App	4.94	5/20/2021	-	-	-	None	-	-	-
2007-1	Second Floor Custodial Closet by Elevator	SS	N/A		5/20/2021	-	-	-	None	Locked Door	-	-
2008-1	Hall by Room M-218	WF	App		5/20/2021	-	-	-	None	Removed from Service	-	-
2008-2	Hall by Room M-218	BF	App	<1.0	5/20/2021	-	-	-	None	-	-	-
2009-1	All Gender Bathroom by Room M-218-right	SK	App	2.6	5/20/2021	-	-	-	None	-	-	-
2010-1	All Gender Bathroom by Room M-218-left	SK	App	2.62	5/20/2021	-	-	-	None	-	-	-
2011-1	Room M-214 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2011-2	Room M-214 Counter @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2011-3	Room M-214 Counter @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2011-4	Room M-214 Counter @ C	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2011-5	Room M-214 Counter @ D	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2011-6	Room M-214 Counter @ E	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2011-7	Room M-214 Counter @ F	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2011-8	Room M-214 Counter @ G	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2011-9	Room M-214 Counter @ H	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2011-10	Room M-214 Counter @ I	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2011-11	Room M-214 Counter @ J	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2011-12	Room M-214 Counter @ K	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2011-13	Room M-214 Counter @ L	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2012-1	Room M-215 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2012-2	Room M-215 Counter @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2012-3	Room M-215 Counter @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2012-4	Room M-215 Counter @ C	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2012-5	Room M-215 Counter @ D	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2012-6	Room M-215 Counter @ E	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2012-7	Room M-215 Counter @ F	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2012-8	Room M-215 Counter @ G	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2012-9	Room M-215 Counter @ H	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2012-10	Room M-215 Counter @ I	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2012-11	Room M-215 Counter @ J	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2012-12	Room M-215 Counter @ K	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2012-13	Room M-215 Counter @ L	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2013-1	Room M-216 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2013-2	Room M-216 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2013-3	Room M-216 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2013-4	Room M-216 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2013-5	Room M-216 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2013-6	Room M-216 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2013-7	Room M-216 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2013-8	Room M-216 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2013-9	Room M-216 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2013-10	Room M-216 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2013-11	Room M-216 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2013-12	Room M-216 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2013-13	Room M-216 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2014-1	Room 285 Teacher's Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2014-2	Room 285 Counter	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
2015-1	Room 286 Life Skills	SK	App	2.75	5/20/2021	-	-	-	None	-	-	-
2015-2	Room 286 Life Skills	SPY	App		5/20/2021	-	-	-	None	Removed from Service	-	-

Laboratory Report

NYE Report #: 2212276-17931

May 21, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Dobbs Ferry Middle School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 20, 2021. New York Environmental analyzed the samples on May 21, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	20 May 2021
Date Received:	20 May 2021
Date Analyzed:	21 May 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210520L001	1	All Gender Bathroom-SK; Initial	1.00	1.10	µg/L	
210520L002	2	Girl's Bathroom by Faculty Room-SK; Initial	1.00	4.20	µg/L	
210520L003	3	Boy's Bathroom by Faculty Room-SK; Initial	1.00	14.9	µg/L	
210520L004	4	Hall by Faculty Room-BF; Initial	1.00	<1.00	µg/L	
210520L005	5	Faculty Room-SK; Initial	1.00	1.64	µg/L	
210520L006	6	Faculty Room-SPY; Initial	1.00	<1.00	µg/L	
210520L007	7	Boy's Bathroom by Cafeteria-SK; Initial	1.00	<1.00	µg/L	
210520L008	8	Girl's Bathroom by Cafeteria-SK; Initial	1.00	<1.00	µg/L	
210520L009	9	Cafeteria (left)-BF; Initial	1.00	<1.00	µg/L	
210520L010	10	Cafeteria-East side-BF; Initial	1.00	<1.00	µg/L	
210520L011	11	Kitchen Ice Machine-IM; Initial	1.00	<1.00	µg/L	
210520L012	12	Kitchen Potfiller-PF; Initial	1.00	2.11	µg/L	
210520L013	13	Kitchen Island - 2-Bay- SK; Initial	1.00	<1.00	µg/L	
210520L014	14	Kitchen 3-Bay-Dishwash Station-SK, Left; Initial	1.00	<1.00	µg/L	
210520L015	15	Kitchen 3-Bay Dishwash Station-SK, Right; Initial	1.00	<1.00	µg/L	
210520L016	16	Kitchen Serving Line (left) by ice cream machine-SK; Initial	1.00	2.38	µg/L	
210520L017	17	Kitchen Serving Line (right) by coffee machine-SK; Initial	1.00	<1.00	µg/L	
210520L018	18	Kitchen Locker Room Bathroom-SK; Initial	1.00	4.08	µg/L	
210520L019	19	Girl's Bathroom by Gym (left)-SK; Initial	1.00	2.69	µg/L	
210520L020	20	Girl's Bathroom by Gym (center)-SK; Initial	1.00	2.17	µg/L	
210520L021	21	Girl's Bathroom by Gym (right)-SK; Initial	1.00	2.75	µg/L	
210520L022	22	Boy's Bathroom by Gym (left)-SK; Initial	1.00	4.00	µg/L	
210520L023	23	Boy's Bathroom by Gym (left)-SK; Initial	1.00	2.12	µg/L	
210520L024	24	Boy's Bathroom by Gym (left)-SK; Initial	1.00	3.71	µg/L	
210520L025	25	Eagle's Nest-SK; Initial	1.00	9.84	µg/L	
210520L026	26	New Gym Women's Locker Room (left)-SK; Initial	1.00	16.5	µg/L	H



Date Collected:	20 May 2021
Date Received:	20 May 2021
Date Analyzed:	21 May 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210520L027	27	New Gym Women's Locker Room (left center)-SK; Initial	1.00	9.71	µg/L	
210520L028	28	New Gym Women's Locker Room (right center)-SK; Initial	1.00	3.54	µg/L	
210520L029	29	New Gym Women's Locker Room (right)-SK; Initial	1.00	33.1	µg/L	H
210520L030	30	New Gym Men's Locker Room (left)-SK; Initial	1.00	9.35	µg/L	
210520L031	31	New Gym Men's Locker Room (left center)-SK; Initial	1.00	3.97	µg/L	
210520L032	32	New Gym Men's Locker Room (center)-SK; Initial	1.00	1.77	µg/L	
210520L033	33	New Gym Men's Locker Room (right center)-SK; Initial	1.00	10.4	µg/L	
210520L034	34	New Gym Men's Locker Room (right)-SK; Initial	1.00	5.87	µg/L	
210520L035	35	Visiting Team Locker Room-SK; Initial	1.00	3.65	µg/L	
210520L036	36	Boy's Bathroom by Room M-220 (left)-SK; Initial	1.00	2.87	µg/L	
210520L037	37	Boy's Bathroom by Room M-220 (right)-SK; Initial	1.00	5.50	µg/L	
210520L038	38	Girl's Bathroom by Room M-220 (left)-SK; Initial	1.00	3.71	µg/L	
210520L039	39	Girl's Bathroom by Room M-220 (right)-SK; Initial	1.00	2.88	µg/L	
210520L040	40	All Gender Bathroom by Room M-200A/B-SK; Initial	1.00	15.8	µg/L	H
210520L041	41	Hall by Room M-220-BF; Initial	1.00	<1.00	µg/L	
210520L042	42	Boy's Bathroom by Room M-219 (left)-SK; Initial	1.00	3.67	µg/L	
210520L043	43	Boy's Bathroom by Room M-219 (right)-SK; Initial	1.00	4.99	µg/L	
210520L044	44	Girl's Bathroom by Room M-219 (left)-SK; Initial	1.00	1.99	µg/L	
210520L045	45	Girl's Bathroom by Room M-219 (right)-SK; Initial	1.00	4.94	µg/L	
210520L046	46	Room 112 Art-SK; Initial	1.00	2.58	µg/L	
210520L047	47	Main Office Kitchen-SK; Initial	1.00	2.03	µg/L	
210520L048	48	Hall by Room M-218-BF; Initial	1.00	<1.00	µg/L	
210520L049	49	All Gender Bathroom by Room M-218-right-SK; Initial	1.00	2.60	µg/L	
210520L050	50	All Gender Bathroom by Room M-218-left-SK; Initial	1.00	2.62	µg/L	
210520L051	51	Room 286 Life Skills-SK; Initial	1.00	2.75	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.



Appendix C

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-1	Boiler Room	SK	N/A		5/20/2021	-	-	-	None	Locked door	-	-
0002-1	New Gym Basement Hall	WF	App		5/20/2021				None	Removed from Service		
0003-1	New Gym Women's Locker Room (left)	SK	App	16.5	5/20/2021				Additional Sampling Required			
0003-2	New Gym Women's Locker Room (left center)	SK	App	9.71	5/20/2021				None			
0003-3	New Gym Women's Locker Room (center)	SK	App		5/20/2021				None			
0003-4	New Gym Women's Locker Room (right center)	SK	App	3.54	5/20/2021				None			
0003-5	New Gym Women's Locker Room (right)	SK	App	33.1	5/20/2021				Additional Sampling Required			
0004-1	New Gym Men's Locker Room (left)	SK	App	9.35	5/20/2021				None			
0004-2	New Gym Men's Locker Room (left center)	SK	App	3.97	5/20/2021				None			
0004-3	New Gym Men's Locker Room (center)	SK	App	1.77	5/20/2021				None			
0004-4	New Gym Men's Locker Room (right center)	SK	App	10.4	5/20/2021				None			
0004-5	New Gym Men's Locker Room (right)	SK	App	5.87	5/20/2021				None			
0005-1	Visiting Team Locker Room	SK	App	3.65	5/20/2021				None			
1001-1	Hall by Room 113	WF	App	9.84	5/20/2021	-	-	-	None	-	-	-
1001-2	Hall by Room 113 Bottle Filler	BF	App	<1.0	5/20/2021	-	-	-	None	-	-	-
1002-1	Board Room Bathroom	SK	App	17.6	5/20/2021				Additional Sampling Required			
1003-1	Girls Bathroom by Business Office (Left)	SK	App	4.15	5/20/2021	-	-	-	None	-	-	-
1003-2	Girls Bathroom by Business Office (Right)	SK	App	4.42	5/20/2021	-	-	-	None	-	-	-
1003-3	Girls Bathroom by Business Office (ADA Stall)	SK	App	20	5/20/2021				Additional Sampling Required			
1004-1	Hall by Business Office	WF	App		5/20/2021	-	-	-	None	Removed from service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1005-1	Custodial Closet by Business Office	SS	N/A		5/20/2021	-	-	-	None	Locked door	-	-
1006-1	Boys Bathroom by Business Office (Left)	SK	App	2.16	5/20/2021	-	-	-	None	-	-	-
1006-2	Boys Bathroom by Business Office (Right)	SK	App	3.81	5/20/2021	-	-	-	None	-	-	-
1007-1	Art Room 117	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1008-1	Hall by Art Room 117	WF	App		5/20/2021	-	-	-	None	Removed from service	-	-
1008-2	Hall by Art Room 117 Bottle Filler	BF	App	<1.0	5/20/2021	-	-	-	None	-	-	-
1009-1	Science Room 118 Teachers Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1009-2	Science Room 118 POD #1 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1009-3	Science Room 118 POD #1 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1009-4	Science Room 118 POD #2 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1009-5	Science Room 118 POD #2 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1009-6	Science Room 118 POD #3 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1009-7	Science Room 118 POD #3 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1009-8	Science Room 118 POD #4 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1009-9	Science Room 118 POD #4 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1009-10	Science Room 118 POD #5 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1009-11	Science Room 118 POD #5 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1009-12	Science Room 118 POD #6 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1009-13	Science Room 118 POD #6 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1009-14	Science Room 118 Fume Hood	SP	N/A		5/20/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1010-1	Science Prep Room between 118 & 119 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1010-2	Science Prep Room between 118 & 119 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1011-1	Science Room 119 Teachers Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1011-2	Science Room 119 POD #1 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1011-3	Science Room 119 POD #1 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1011-4	Science Room 119 POD #2 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1011-5	Science Room 119 POD #2 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1011-6	Science Room 119 POD #3 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1011-7	Science Room 119 POD #3 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1011-8	Science Room 119 POD #4 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1011-9	Science Room 119 POD #4 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1011-10	Science Room 119 POD #5 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1011-11	Science Room 119 POD #5 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1011-12	Science Room 119 POD #6 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1011-13	Science Room 119 POD #6 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1011-14	Science Room 119 Fume Hood	SP	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
1012-2	Custodial Closet by New Gym	SS	N/A		5/20/2021	-	-	-	None	Locked Door	-	-
1013-1	Girl's Bathroom by Gym (left)	SK	App	2.69	5/20/2021	-	-	-	None	#REF!	-	-
1013-2	Girl's Bathroom by Gym (center)	SK	App	2.17	5/20/2021	-	-	-	None	#REF!	-	-
1013-3	Girl's Bathroom by Gym (right)	SK	App	2.75	5/20/2021	-	-	-	None	#REF!	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1013-4	Hall by Gym (left)	WF	App		5/20/2021	-	-	-	None	Removed from Service	-	
1013-5	Hall by Gym (right)	WF	App		5/20/2021	-	-	-	None	Removed from Service	-	
1013-6	Boy's Bathroom by Gym (left)	SK	App	4	5/20/2021	-	-	-	None	#REF!	-	
1013-7	Boy's Bathroom by Gym (left)	SK	App	2.12	5/20/2021	-	-	-	None	#REF!	-	
1013-8	Boy's Bathroom by Gym (left)	SK	App	3.71	5/20/2021	-	-	-	None	#REF!	-	
1014-1	Gym by entrance	WF	App		5/20/2021	-	-	-	None		-	
1014-2	Gym by Athletic Office	WF	App		5/20/2021	-	-	-	None		-	
1015-1	Eagle's Nest	SK	App		5/20/2021	-	-	-	None		-	
1016-1	Accounting Room 105 Bathroom	SK	App	6.71	5/20/2021	-	-	-	None	-	-	-
2001-1	Nurses Office Bathroom	SK	App	1.08	5/20/2021	-	-	-	None	-	-	-
2002-1	Hall by Room 216	WF	App		5/20/2021	-	-	-	None	Removed from service	-	-
2002-2	Hall by Room 216 Bottle Filler	BF	App	<1.0	5/20/2021	-	-	-	None	-	-	-
2003-1	Boys Bathroom by Room 203 (Left)	SK	App	2.23	5/20/2021	-	-	-	None	-	-	-
2003-2	Boys Bathroom by Room 203 (Right)	SK	App	2.23	5/20/2021	-	-	-	None	-	-	-
2004-1	Custodial Closet by Room 203	SS	N/A		5/20/2021	-	-	-	None	Locked door	-	-
2005-1	Womens Faculty Bathroom by Room 204 (Left)	SK	App	4.36	5/20/2021	-	-	-	None	-	-	-
2005-2	Womens Faculty Bathroom by Room 204 (Right)	SK	App	3.15	5/20/2021	-	-	-	None	-	-	-
2005-3	Womens Faculty Bathroom by Room 204 (ADA Stall)	SK	App	6.53	5/20/2021	-	-	-	None	-	-	-
2006-1	Hall by Room 202	WF	App		5/20/2021	-	-	-	None	Removed from service	-	-
2007-1	Hall by Room 212	WF	App		5/20/2021	-	-	-	None	Removed from service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2008-1	Principals Office Bathroom	SK	App		5/20/2021	-	-	-	None	-	-	-
3001-1	Science Prep Room 319	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3002-1	Science Room 318 Teachers Station	SK	App	2.95	5/20/2021	-	-	-	None	-	-	-
3002-2	Science Room 318 POD #1 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3002-3	Science Room 318 POD #1 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3002-4	Science Room 318 POD #2 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3002-5	Science Room 318 POD #2 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3002-6	Science Room 318 POD #3 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3002-7	Science Room 318 POD #3 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3002-8	Science Room 318 POD #4 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3002-9	Science Room 318 POD #4 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3002-10	Science Room 318 POD #5 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3002-11	Science Room 318 POD #5 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3002-12	Science Room 318 POD #6 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3002-13	Science Room 318 POD #6 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3003-1	Science Room 317 Teachers Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3003-2	Science Room 317 POD #1 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3003-3	Science Room 317 POD #1 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3003-4	Science Room 317 POD #2 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3003-5	Science Room 317 POD #2 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3003-6	Science Room 317 POD #3 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3003-7	Science Room 317 POD #3 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3003-8	Science Room 317 POD #4 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3003-9	Science Room 317 POD #4 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3003-10	Science Room 317 POD #5 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3003-11	Science Room 317 POD #5 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3003-12	Science Room 317 POD #6 @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3003-13	Science Room 317 POD #6 @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3004-1	Hall by Science Room 317	WF	App		5/20/2021	-	-	-	None	Removed from service	-	-
3005-1	Science Room 316 Teachers Station	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3006-1	Mens Faculty Bathroom by Room 301 (Left)	SK	App	5.29	5/20/2021	-	-	-	None	-	-	-
3006-2	Mens Faculty Bathroom by Room 301 (Right)	SK	App	6.47	5/20/2021	-	-	-	None	-	-	-
3007-1	Custodial Closet by Room 301	SS	N/A		5/20/2021	-	-	-	None	Locked door	-	-
3008-1	Girls Bathroom by Room 301 (Left)	SK	App	5.71	5/20/2021	-	-	-	None	-	-	-
3008-2	Girls Bathroom by Room 301 (Right)	SK	App	1.87	5/20/2021	-	-	-	None	-	-	-
3008-3	Girls Bathroom by Room 301 (ADA Stall)	SK	App	16.8	5/20/2021				Additional Sampling Required			
3009-1	Science Room 301 Counter @ A	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3009-2	Science Room 301 Counter @ B	SK	N/A		5/20/2021	-	-	-	Sign Required	-	-	-
3010-1	Hall by Room 311	WF	App		5/20/2021	-	-	-	None	Removed from service	-	-

Laboratory Report

NYE Report #: 2212277-17932

May 21, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Dobbs Ferry High School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 20, 2021. New York Environmental analyzed the samples on May 21, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	20 May 2021
Date Received:	20 May 2021
Date Analyzed:	21 May 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210520L052	1	Hall by Room 113 Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
210520L053	2	Board Room Bathroom-SK; Initial	1.00	17.6	µg/L	H
210520L054	3	Girls Bathroom by Business Office (Left)-SK; Initial	1.00	4.15	µg/L	
210520L055	4	Girls Bathroom by Business Office (Right)-SK; Initial	1.00	4.42	µg/L	
210520L056	5	Girls Bathroom by Business Office (ADA Stall)-SK; Initial	1.00	20.0	µg/L	H
210520L057	6	Boys Bathroom by Business Office (Left)-SK; Initial	1.00	2.16	µg/L	
210520L058	7	Boys Bathroom by Business Office (Right)-SK; Initial	1.00	3.81	µg/L	
210520L059	8	Hall by Art Room 117 Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
210520L060	9	Mens Bathroom by Boys Locker Room-SK; Initial	1.00	16.7	µg/L	H
210520L061	10	Boys Locker Room Bathroom-SK; Initial	1.00	6.01	µg/L	
210520L062	11	All Gender Bathroom by Girls Locker Room-SK; Initial	1.00	7.62	µg/L	
210520L063	12	Girls Locker Room-WF; Initial	1.00	209	µg/L	E,H
210520L064	13	Girls Locker Room (Left)-SK; Initial	1.00	34.5	µg/L	H
210520L065	14	Girls Locker Room (Right)-SK; Initial	1.00	58.3	µg/L	E,H
210520L066	15	Accounting Room 105 Bathroom-SK; Initial	1.00	6.71	µg/L	
210520L067	16	Nurses Office Bathroom-SK; Initial	1.00	1.08	µg/L	
210520L068	17	Hall by Room 216 Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
210520L069	18	Boys Bathroom by Room 203 (Left)-SK; Initial	1.00	2.23	µg/L	
210520L070	19	Boys Bathroom by Room 203 (Right)-SK; Initial	1.00	2.23	µg/L	
210520L071	20	Womens Faculty Bathroom by Room 204 (Left)-SK; Initial	1.00	4.36	µg/L	
210520L072	21	Womens Faculty Bathroom by Room 204 (Right)-SK; Initial	1.00	3.15	µg/L	
210520L073	22	Womens Faculty Bathroom by Room 204 (ADA Stall)-SK; Initial	1.00	6.53	µg/L	
210520L074	23	Principals Office Bathroom-SK; Initial	1.00	59.0	µg/L	E,H
210520L075	24	Science Prep Room 319-SK; Initial	1.00	2.95	µg/L	
210520L076	25	Mens Faculty Bathroom by Room 301 (Left)-SK; Initial	1.00	5.29	µg/L	
210520L077	26	Mens Faculty Bathroom by Room 301 (Right)-SK; Initial	1.00	6.47	µg/L	



Date Collected:	20 May 2021
Date Received:	20 May 2021
Date Analyzed:	21 May 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210520L078	27	Girls Bathroom by Room 301 (Left)-SK; Initial	1.00	5.71	µg/L	
210520L079	28	Girls Bathroom by Room 301 (Right)-SK; Initial	1.00	1.87	µg/L	
210520L080	29	Girls Bathroom by Room 301 (ADA Stall)-SK; Initial	1.00	16.8	µg/L	H

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.